

# CENTER 317

# HUMIDITY TEMPERATURE METER

(DEW POINT & WET BULB)



CE

## Feature:

- Dew Point and Wet Bulb temperature Measurement.
- Fast response.
- Auto shut off for Battery Saving.
- MAX/MIN Function.
- Dual displays:  
Primary display for Humidity;  
Secondary displays for temperature.

**CENTER**®



# CENTER 317 HUMIDITY TEMPERATURE METER

## SPECIFICATIONS

### Measurement Range:

Temperature: -20°C~60°C; -4°F~140°F

Humidity: 0%RH~100%RH

**Resolution:** 0.1°C/0.1°F/0.1%RH

### Accuracy:

Temperature: ±0.8°C, 1.6°F

Humidity: ±2.5%RH

**Sampling Rate:** 2 times/sec

### Humidity Sensor:

Electronic capacitance polymer film sensor.

**Battery Type:** 1.5V AA size battery x 4

**Operating Condition:** 0°C to 40°C (<80%RH)

**Dimensions:** 210×65×43mm

**Accessories:** Batteries, Instruction Manual




LED Back Light

1:1 Size



33%RH / 75%RH  
Humidity Standard (OPTIONAL)

## Dual Display

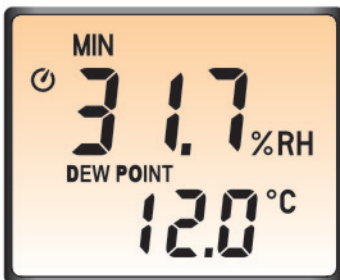

Primary display  
for Humidity;  
Secondary displays  
for temperature.

Pull Up  
Sensor  
Protector.



**CENTER**<sup>®</sup>  
**CENTER TECHNOLOGY CORP.**

4/F., NO.415, Jung-Jeng Rd., 238 Shu-Lin, Taipei, Taiwan  
TEL: 886-2-26763926 E-Mail: center@centertek.com  
FAX: 886-2-26763925 http://www.centertek.com

Distributed by:

\* The specifications and other information in this catalogue are subject to change without prior notice.